# **VEO+ Public Manifest**

# **VEO+ 3.10**

# **Important Application Notice**

None

## **Improvements**

#### 2016-05-02 VEO+ Release 3.10.11

Fix 90 Error in FL calculation - Beam exit point outside wedge

### 2016-04-21 VEO+ Release 3.10.10

1476 Update for multiple OS security fixes. 1584 New layout for 5 Scan that includes a B-Scan.

Fix 1397 Mono DAC interface. Fix 1490 UT function noise.

### 2016-03-15 VEO+ Release 3.10.8

First public release.

### Known Issues in VEO+ Release 3.10

- 32 File loaded from USB key cannot be saved after removing the key.
- 40 Maximizing Merged C-scan view clears the view.
- 565 3D views improvement for P&C functionalities.
- 609 Screen brightness parameter missing.
- 635 WiFi refresh button in configuration screen not working. WA turn OFF/ON the antenna.
- 601 WiFi right password isn't recognize correctly after reboot WA re-enter password.
- 592 Auto FSH in DGS wizard not accurate WA make manual adjustment.
- 363 Wheel touch doesn't work while in velocity wizard WA use arrows.
- 322 F3 reset shortcut doesn't work when 2D quadrature encoded WA manual reset.
- 280 Measures in Part References don't consider Encoding Area offset+rotation.
- 263 Reset all in Time-based should reset all data WA manual reset.
- 236 Sometimes split DAC vertical lines are not drawn.
- 231 Redundant info in 3D view or wrong abbreviation used for focal distance.
- 1439 AQR indicator unespected behavior when having 2 TOFD scans.
- 1541 Part Thickness and geometry index offset breaks calibration